



BACKED BY  
**Roadranger**  
SUPPORT

**Subject:** Single PTO Transmission Service Units built with Dual (4-Bolt) PTO Rear Housings – Endurant HD

**Document Number:** TAIB-1010


**Date:** January 16, 2024

**Updated:**

## Issue Description:

Some Single PTO transmission service units are built with Dual (4-Bolt) PTO Rear Housings. These units are based on a Single PTO model and do not include the internal components to support 4-Bolt PTO operation. If a 4-Bolt PTO is installed, PTO and/or transmission component damage will occur.

Single PTO and Dual (4-Bolt) PTO Rear Housing identification:

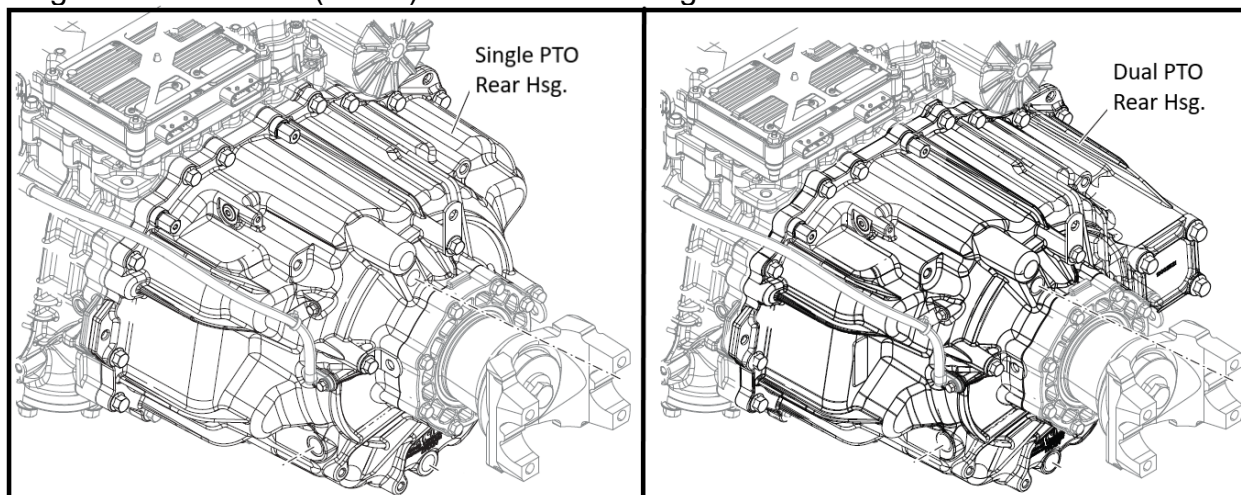

## Affected Models/Population:

Endurant HD Single PTO Transmission Service Units:

Transmission Model	TN Number - Part Number	Serial Number Prefix
EEO-18F112C	TN-H04-75RR	PR
		RR
		ZJ
		ZR
	TN-H04-12R	RU

## Service Bulletin – Product


### Field Strategy:

Refer to [TRSM0950 Transmission Service Unit, Reman or Complete, Part Number Identification](#) to determine the correct Single PTO or Dual PTO transmission service unit part number.

Locate transmission tag on clutch housing and record TN#. If the transmission tag indicates TN-H04-75RR or TN-H04-12R and the rear housing is equipped with a 4-Bolt PTO opening, do not install a 4-Bolt PTO.

**CAUTION:** Do not install a 4-Bolt PTO on to a TN-H04-75RR or TN-H04-12R Single PTO transmission service unit equipped with a Dual (4-Bolt) Rear Housing. These service units do not include the internal components to support 4-Bolt PTO operation. If a 4-Bolt PTO is installed, PTO and/or transmission component damage will occur.


TN-H04-75RR transmission tag example:

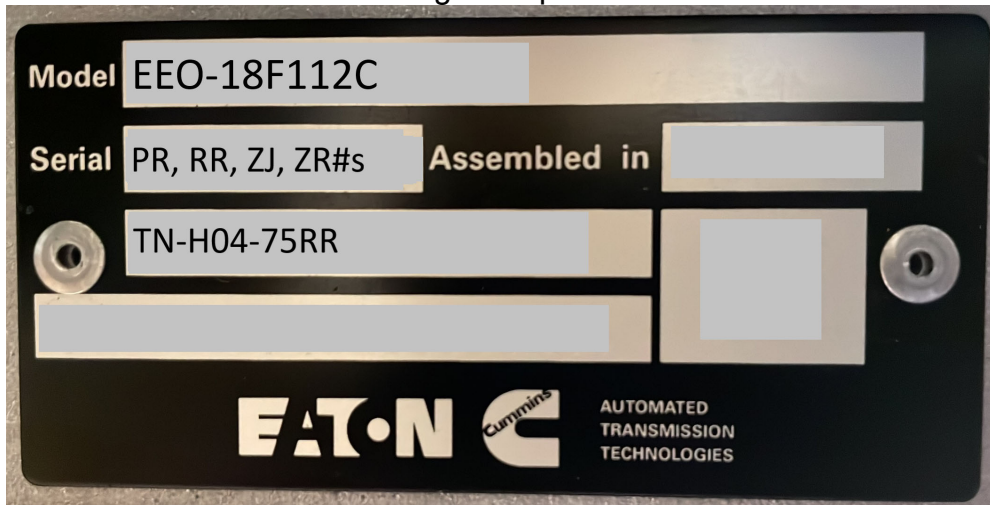

TN-H04-12R transmission tag example:



Transmission tag location:

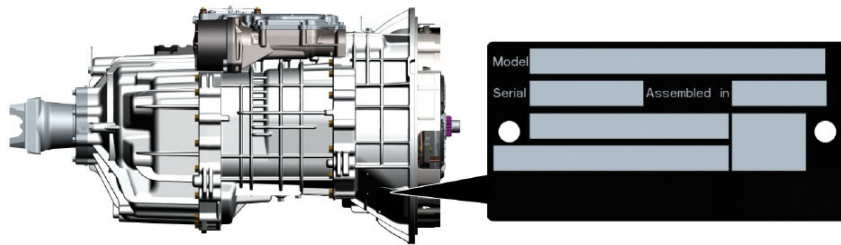

### Warranty Information:

Warranty coverage is not provided for component damage resulting from installing a 4-Bolt PTO on a TN-H04-12R or TN-H04-75RR, Single PTO transmission service unit equipped with a Dual PTO Rear Housing.

The material contained in this bulletin is product improvement information. Eaton Corporation is not committed to, or liable for, canvassing existing products. FSUD: 2024-FSUD-4593

### Keyword Index:

1. Dual PTO
2. Rear Housing
3. 4 Bolt